



AB McLAUCHLAN :: WELLIVER METAL


**Service Bulletin #07-88  
December 5, 1988**

**Attention: Parts Manager and Service Manager  
RE: High Pressure Check Valves (part # 500-044)**


In October, 1986 we started using a new style High Pressure Check Valve (with hardened seats) in all D-550s and H-500 and F-525 Hand Pumps. Refer to service bulletin #01-86 dated October 29, 1986. At that time we kept the original part number, 500-044, for the new valves.

The new style hardened Valves do not always provide "Zero Leakage" which is required on Hand Pumps (to prevent "Bleed Off" from the cylinders). Starting at paver serial number H-10107-B-8 we are reverting back to our original check valves in ALL HAND PUMP applications. The Hand Pump check valves will be part # 500-044. The hardened seat check valves (now to be used in D-550 Pavers ONLY) will now be part # 550-108.

**550-108**

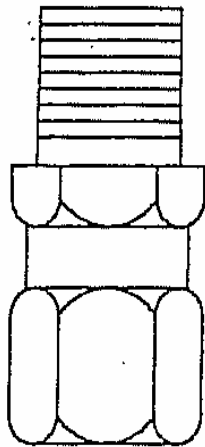

**500-044**

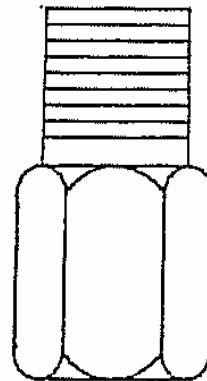

The two check valves are readily identifiable by sight. When a customer orders 500-044 check valves, it will be NECESSARY to determine what model paver they are going to be used on and supply the proper one. DO NOT INTERCHANGE these two different check valves.